Libertytown Maryland vicinity
Frederick County, Maryland

The Reisler Farmstead consists of a 2 1/2 story brick dwelling built about 1855 and several domestic outbuildings, including a stone smokehouse and a frame summer kitchen, and a frame bank barn and a hog barn among the agricultural outbuildings. The house is unusual for the 2 1/2 story height. This type of house was more frequently built in towns rather than in rural locations in the mid-19th century. The interior has grained wood trim in the principal rooms of the main section.

Survey No. F-8-120 Reisler Farmstead Libertytown, Maryland vicinity Frederick County

HISTORIC CONTEXT:

MARYLAND COMPREHENSIVE HISTORIC PRESERVATION PLAN DATA

Geographic Organization: Piedmont (Harford, Baltimore, Carroll, Frederick, Howard, Montgomery Counties, and Baltimore City)

Chronological/Development Period:
Agricultural-Industrial Transition 1815-1870 A.D.

Prehistoric/Historic Period Themes:
Architecture, Landscape Architecture, Community Planning

Resource Type:

Category: Building

Environment: Rural

Function & Use:
Domestic/single dwelling/residence
Domestic/secondary structure/kitchen
Domestic/secondary structure/smokehouse
Agriculture/Subsistence/animal facility/barn

Known Design Source: None

Reisler Farmstead Libertytown, Maryland vicinity Frederick County, Maryland

7.1 Description

The Reisler Farmstead is an originally agricultural complex, now a private residence and separately leased farm, consisting of a circa 1855, 2 1/2 story brick dwelling house with 7 domestic outbuildings and three agricultural outbuildings ranging in date from contemporary with the house to the second quarter of the 20th century. The farmstead is located on the west side of Green Valley Road (MD Rt. 75), about 1500 ft. south of Coppermine Road, near Libertytown, Maryland. The house and outbuildings are about 50 yards off the main road in full view. The outbuildings include a frame summer kitchen adjoining the house's rear wing, a circa 1855 stone smokehouse, two chicken houses, a privy, a hog barn, a bank barn approximately contemporary with the house, a garage, and a gas shed.

The dwelling house is a 3-bay brick building in 7-course American bond with interior end chimneys, a standing seam metal gable roof and a stone foundation. It has a one-story porch on the east elevation and a two-story porch on the south elevation of the rear wing or ell which extends from the northwest corner of the main section. The windows are 6/6 on the first and second stories and 3/3 on the top half-story which is the attic. There are two doorways in the east elevation in the middle and south bays, each having a three-panel door with a glazed upper panel and a three-light transom. The porch has four square columns and a concrete platform, a replacement of the original wood deck. The cornice is corbelled brick. The north and south elevations each have two window bays flanking the chimney. On the north elevation, the west bay has been enclosed by a frame, horizontal wood-sized structure, which is a bathroom added in the mid-20th century. The rear wing or ell is two stories in height. The south elevation of the ell has an open two-level porch with a plain balustrade on the second floor. At the west elevation of the ell is a central projection rising the height of the house which encloses the chimney of the The wood cornice of the ell's roof extends around the kitchen fireplace. chimney stack with returns on the west face.

The plan of the house is basically a side hall type, with the variation of the two entrances in the east elevation. The staircase is on the interior wall of the parlor rather than in the hall. At the rear of the parlor is a cross hall connecting the side hall and the entrance to the ell. An extension of the single space in the ell is located on the north side of the ell. A corner stairway is located on the southwest corner of the ell. The main hall has grained wood four-panel doors and grained plain architraves on the window and The walls are plaster under mid-20th century wallpaper. On door surrounds. the south wall of the hall is the outline of a stovepipe opening in the location of the original chimney and fireplace opening. No other evidence of the fireplace is visible. The parlor has grained wood trim and a simple paneled mantel on the north wall. The fireplace opening is closed. A plaster elliptical arch drops from the ceiling at the rear of the room and the outline of a stovepipe is visible in the northwest corner. This may indicate a possible altered double parlor floor plan, but further research is needed to clarify the plan. The staircase is enclosed and accessible through a door at the foot of the stairs. The cross hall at the rear of the main section has plaster walls and a wide board floor. Similar floors in the side hall and parlor are covered with carpeting. A corner cupboard with plain paneled doors is located on the southeast corner of the cross hall, backed by the stairs in the parlor.

Reisler Farmstead Libertytown, Maryland vicinity Frederick County, Maryland

7.2 Description

The ell has been most altered among the first floor spaces. Rear wings in many houses of the same period in Frederick County had two rooms. The Reisler House ell is a single room with masonite paneled walls which conceal any evidence of a removed interior wall. An extension of the north side of the space is separated from the main area storage cabinets and countertops. The location of the fireplace on the west wall is completely obscured; only the exterior projection identifies its original location. The stairway in the southwest corner of the ell is open at the foot and enclosed by masonite paneled walls. The floor is covered with carpet.

Domestic Outbuildings:

Summer kitchen: The frame summer kitchen is a one-story structure adjoining the west end of the porch on the house ell. It has german siding, a corrugated metal roof, and an exterior brick and stone chimney on the west gable end. The interior has a tongue-and-groove horizontal paneled wainscot, vertical flush board doors in each gable end, and a plain wood mantel over the fireplace opening. The building appears to date from the 1850's.

Milk house: Adjoining the summer kitchen on the south elevation is a small roughly rectangular frame shed, with a corrugated metal roof and german siding. Small square 2/2 windows are located in the east and west elevations. A vertical flush board door opens in the south elevation. The milk house was used to store sterilized milk cans and was possibly built in the 1920's or 1930's.

Smokehouse: The smokehouse is a square stone building northwest of the house. It probably dates from the 1850's. The stone section is topped by a frame upper section which extends eastward from the stone base to form a partially enclosed equipment shed. The frame structure is covered with board and batten siding. The gable roof covering the entire structure is corrugated metal. The interior fireplace in the smokehouse has a massive wood beam over the fireplace opening.

Chicken houses: Two chicken houses are included in the domestic group. One is located north of the house and has german siding and a shed roof with a center door flanked by two square windows, facing south. The second chicken house is located southwest of the house and has vertical siding covered with corrugated metal siding and a shed corrugated metal roof. It has two doors in its east elevation flanked by windows of varying configuration. Both houses are primarily used for storage of tools and other equipment. Their construction date is possibly in the first decade of the 20th century.

Garage: The early 20th century garage is a frame building with vertical siding covered with metal siding in the mid-20th century. The gable roof is also covered with corrugated metal.

Privy: The late 19th century privy is a square building with german siding and a four-panel door under a shed corrugated metal roof located behind the chicken house southwest of the house.

7.3 Description

Bank barn: The bank barn was probably built in the third quarter of the 19th century, with vertical siding and some interior structure possibly dating from the last quarter of the 19th century. Metal siding has been applied over the wood siding on the north, east, and west elevations. The forebay on the south elevation and the feeding floor are undivided, retaining double feeding aisles, granaries, and mangers. Niches in the stone end walls for veterinary supplies are visible. The barn has a corn crib and wagon shed on the west elevation.

Hog barn: The hog barn was built in the first quarter of the 20th century. It has vertical siding and a gable roof covered with corrugated metal. The plan is typical of small animal barns, with a feeding aisle across its north side and four pens occupying the rest of the building. A concrete block wallow is attached to the south elevation. A single door is located in the north elevation, with a feed door above it.

Gas shed: This is a frame, open-sided shed located northwest of the house. It has vertical board siding and a corrugated metal roof. The open side faces east. Presently used to store gas tanks, the shed may have had other agricultural uses. Its date is unknown, but it could have been built in the second quarter of the 20th century. Nearby is a concrete floor slab, the site of a 19th century hog shed which was recently demolished by the current owner. A circular chicken house of the early 20th century stood just east of the chicken house north of the dwelling house; it was demolished in 1980.

Reisler Farmstead Libertytown, Maryland vicinity Frederick County, Maryland

8.1 Significance

The Reisler Farmstead is significant for the unusual architecture of the dwelling house, a 2 1/2 story brick building in a rural location. The context of residential structures with additional half stories is still being compiled; structures of this type have been located, however, its appearance in a largely unaltered exterior such as the Reisler house is unusual in the northeastern section of Frederick County.

The clear definition of the half story in the east elevation suggests the facade of an urban house such as those in the Frederick City Historic District rather than a farm dwelling.

The house may have been built by Owen and Thomas J. Reisler, who apparently operated the Liberty Copper Mine in the 1870's, as their names appear on the C.O. Titus Atlas Map of 1873, at the mine site on Coppermine Road a few miles northwest of the farmstead. The Reislers purchased the property in 1852 and T.J. Reisler's name is associated with the house site on the 1858 Isaac Bond Map and the 1873 Titus Map. It remained in the Reisler family until 1906.

Maryland Historical Trust HISTORIC PROPERTIES State Historic Sites Inventory Form

Survey No. F-8-120

Magi No.

DOE __yes X_no

1. Nam	e (indicate pro	eferred name)				
historic Reisl	er Farmstead					
and/or common						
2. Loca	ation				3.000	
street & number	9910 Green Valley	Road			not for publication	on
city, town $^{ m Lib}$	ertytown	x_ vicinity of	congressional di	strict 6	th	
state ^{Maryla}	ind	county	Frederick			
3. Clas	sification					
Category district _X_ building(s) structure site object	Ownership public private both Public Acquisition in process being considered not applicable	Status _X occupied unoccupied work in progress Accessible _X yes: restricted yes: unrestricted no	Present Use agriculture commercia educations entertainm governme industrial military	al al ient	museum park X private resid religious scientific transportatio	
<u>4. Own</u>	er of Prope	rty (give names a	nd mailing add	resses	of <u>all</u> owners	3)
name Larue	E. Moxley & W. Dwi	ght Repp				•••
street & number	18939 Treebranch	Terrace	teleph	one no.	:	
city, town Ger	man town	state	and zip code	MD	20874	
5. Loca	ation of Lega	al Description	on			
courthouse, regis	stry of deeds, etc. Fred	erick County Courth	louse		liber 1579	
street & number	100 W. Patrick St				folio 93	
city, town	Frederick			state MD	21701	
6. Repi	resentation	in Existing	Historical	Survey	/S	
title						
date			federal _	state	county	_ local
pository for su	rvey records					
city, town				state		

7. Description Survey No. F-8-120					
Condition excellent good fair	deteriorated ruins unexposed	Check one unaltered altered	Check one x original site moved date of mov	e	

Prepare both a summary paragraph and a general description of the resource and its various elements as it exists today.

Contributing Resource Count: 11

(Typed on separate sheet)

8. Significance			Survey No. F-8-120		
Period prehistoric 1400–1499 1500–1599 1600–1699 1700–1799 X 1800–1899 1900–	archeology-historic agriculture x architecture	Check and justify below community planning conservation economics education engineering exploration/settlemen industry invention	law literature military muslc tt philosophy politics/government	religion science sculpture social/ humanitarian theater transportation other (specify)	
Specific dates	Ca. 1855	Builder/Architect			
а Арр 1	icable Criteria:A and/or icable Exception:	ABCD			
	of Significance:				
support.		of significance and	a general statement of	history and	
(Typed on s	enarato chooti				

(Typed on separate sheet)

9. Major Bibliographical References

Survey No. F-8-120

Land Records of Frederick County Titus, C.O., Atlas of Frederick County, 1873 Bond, Isaac, Map of Frederick County, 1858

10. Geographic	al Data			
Acreage of nominated property Quadrangle name Union Bridge JTM References do NOT comple	, Maryland	rences	Quadran	gle scale 1:24000
Zone Easting North	ing	B Zone	Easting	Northing
C		D F H		
Verbal boundary description and Concurrent with Tax Map 5				
List all states and counties for	properties over	lapping state or c	ounty boundarie	S
state	code	county		code
state	code	county		code
11. Form Prepa	red By			
name/title Janet L. Davis, I	Historic Site	es Surveyor		
organization Frederick County	Planning &	Zoning Dept. c	date July, 19	91
street & number 12 E. Church	St.	t	elephone 301	-696-2958
city or town Frederick			state MD 21701	

The Maryland Historic Sites Inventory was officially created by an Act of the Maryland Legislature to be found in the Annotated Code of Maryland, Article 41, Section 181 KA, 1974 supplement.

The survey and inventory are being prepared for information and record purposes only and do not constitute any infringement of individual property rights.

return to:


Maryland Historical Trust Shaw House


21 State Circle

Annapolis, Maryland 21401

(301) 269-2438

MARYLAND HISTORICAL TRUST DHCP/DHCD 100 COMMUNITY PLACE CROWNSVILLE, MD 21032-2023 301-514-7600

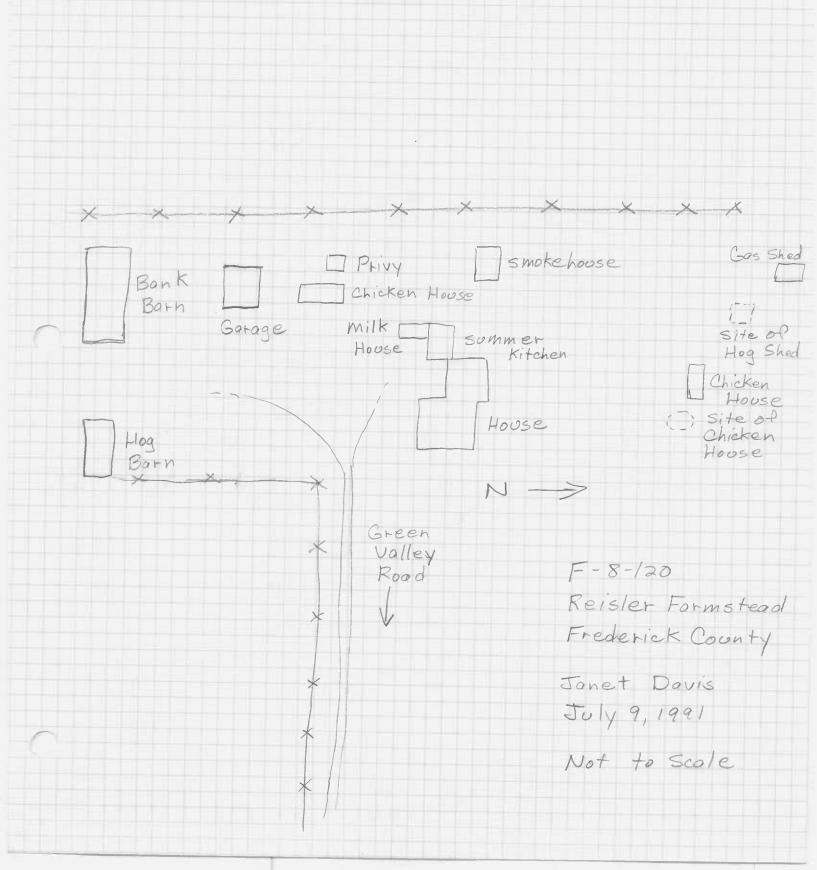

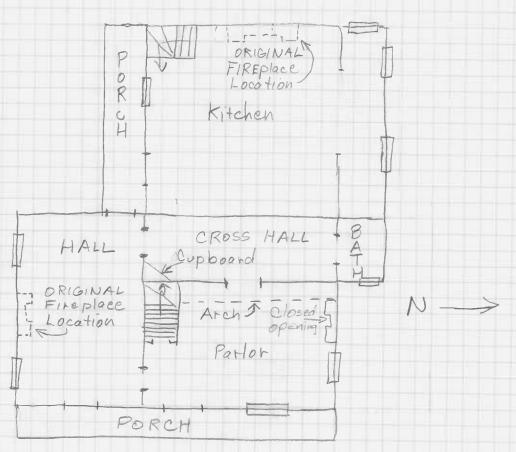



F-8-120
Reisler House
Frederick County

Janet Davis
July 9, 1991

Not to Scale

9910 Green Walley Rd. M51 P6						
LIBER/FOL.J	GRANTEE	GRANTOR	ORIGINAL TRACTS	COST	DATE	
1579/93	Larue & Mosley	Mary E. Repp, dec)				
21gun 89	M. Dwight Pepp	Larue E. Moxley				
		Larue E. Moxley Nr. Devight Repp Successor Pels. Rep. of C	Tlate			
441/517	Walter S. Refsp	Deala M. Lowman				
28 Mar 44	Mary E. Repp, sub. Walter J. Repp, son	· · · · · · · · · · · · · · · · · · ·				
342/339	. //	JohnM. + avie C. Smith	Calso montiais			
26 Mai 23	Lowman	Since	344/589 John Wh.	the S		
212 61	01 0 1 9 1/4	00. 1 de: Mish	isa.	7		
312/34 15 Feb-15	13 Summers	George S. Thillieb.		96624.75		
	John M. Smith	50Q.	Wengfield's (sis) Delight"			
2 1/1	00 11.	Developed of Garage	11			
304/121 3 Mar 13	George S. Seconnas	Nesley J. & Lacy B. Summers				
Somar 13						
292/+18	Mesley J.	Henry G. + annie	9034 Q.	\$7000	77	
292/518 24 Sep 10	Summers	Padaliffa (amie formerly Cernie Lahmeller			8-	
·	and lasteness Day	Coliffs & Geo. O. Dears	May 15416 1907		20	
276/450	Commie Lahmuller	Thomasg. Reislegs	2 1 1 West 1 5 7 10,1901	\$6600		
3 Now 06						
	Cowen Reisler & wife deed 26 Mary 187	conveyed their interest i	to Thos. J. Reisler ley			
ES 2/581	Owen Reisler, Ceril	Meston scott, Carollo	-	\$1500		
14 aug. 1852	+ Thos. J. Reisley &c.	V				

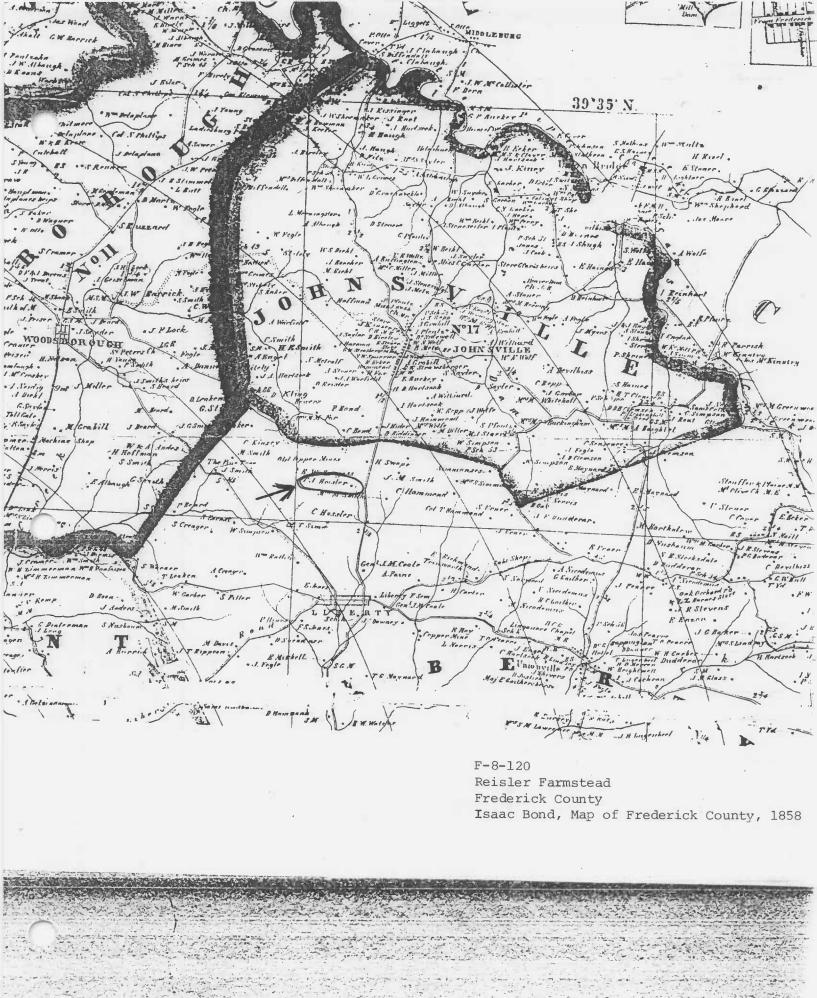

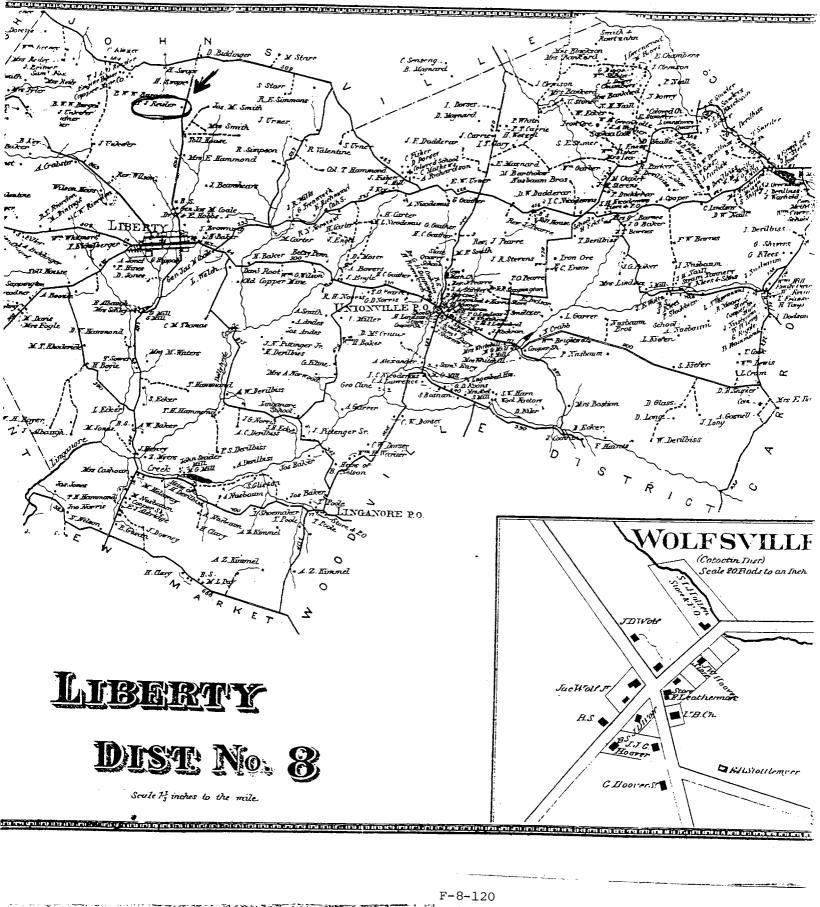

Reisler Farmstead Frederick County C.O. Titus, Atlas of Frederick County, 1873

and the second second






F-8-120 Reisler Formstead Frederick County Photo: Janet Davis July 1991 Neg. loc.: Md. SHPO, Crownsville, Md. East elevation



F-8-120 Reisler Formstead Frederick County Photo: Jonet Davis July 1991 Mea. loc: Md. SHPO Crownsville, Md South elevation 2/10

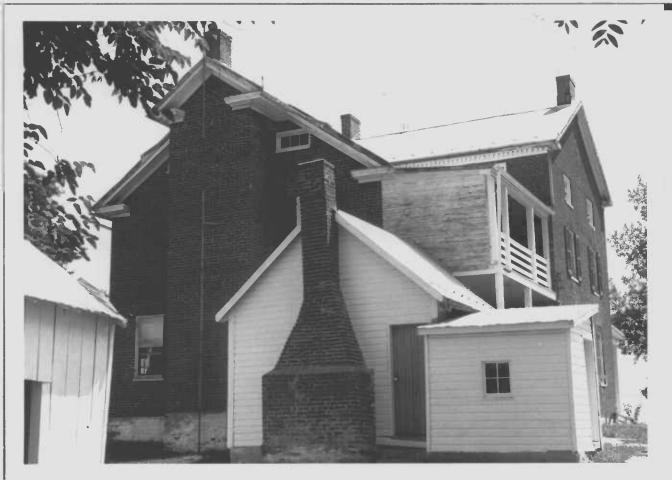

F-8-120 Reislet Formstead Frederick County Photo: Jonet Davis July 1991 Neg. 100: Md. SHPO, Crownsville, Md West elevation and summer kitchen and milk house 3/10




F-8-120 Ruislet Formstead Frederick County Photo : Jonet Davis July 1991 Nog. loc. : Md. SHPO, Crownsville Md. North parlor montelpiece 4/10



F-8-120 Reislet Formstead Frederick County Photo: Janet Davis July 1991 Nea. loc: Md. 5+1PO, Crownsville, Md. Graining detail, main hall 5/10



F-8-120 Reislet Farmstead Frederick County Photo: Janet Dovis July 1991 Neg. loc: Md. SHPO, Crownsville Md Summer kitchen interior dotail 6/10

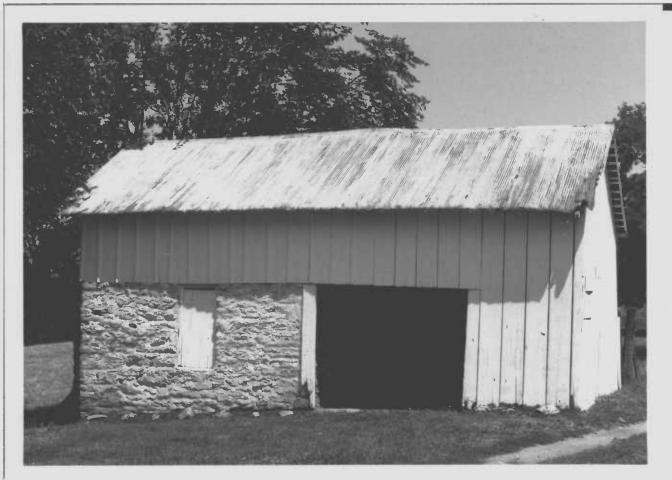


F-8-120 Reisler Form stead Frederick County Photo: Janet Davis JUN 1991 Neg loc. : Md. SHPO, Crownsville, Md. Smokehouse, south elevation 7/10



I-8-120 Reisler Farmstead Frederick County Proto: Janet Davis July 1991 Nea loc. Md. SHPO, Crownsville, md Bank born, north elevation 8/10



F-8-120 Reislet Farm stead Frederick County Photo: Janet Douis July 1991 Neg. loc. i Md. SHPO, Crownsville, Md Bank born, forekay detail 9/10

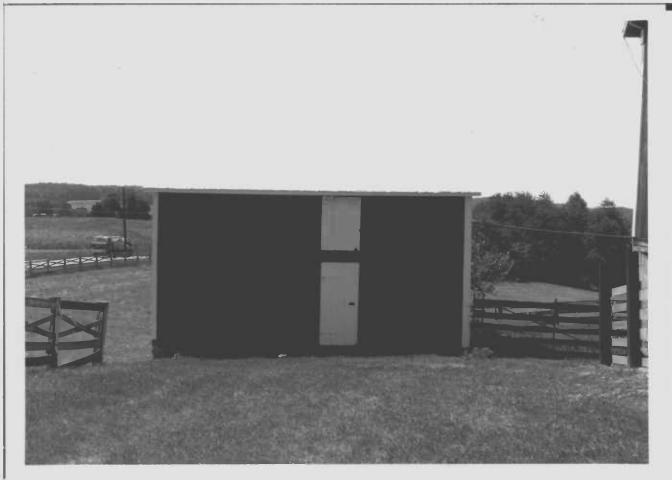

F-8-120 Reisler Formstead Frederick County Photo: Jonet Davis July 1991 Neg. loc. md SHPO, Crownsville, Md Hog born, north elevation 10/10